

# Manhole Inspection Summary

Manhole # S05Y\_\_010MH

Printed On: 6/24/2010

Page 1 of 5

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **05Y** Node: **010** Status: **Found**

Insp Date: **2/5/09 10:44 AM**

Incomplete Comments

Crew: **SD WJ**  
Inspector: **Lamont**  
Firm: **URS**

**Location** Address: **SOUTHWESTERN BLVD**

Cross Street: **JOH AVE**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover**

Shape: **Circular**

Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **12** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **19** Missing: **0** ☐ Corroded

**Surcharge**

☒ **Evidence Of Surcharge** Depth: **6** (ft.) ☐ Active Surcharge Present

Location View




SEALED PIPE ABOVE I9




BARREL INFILTRATION

Defect 5

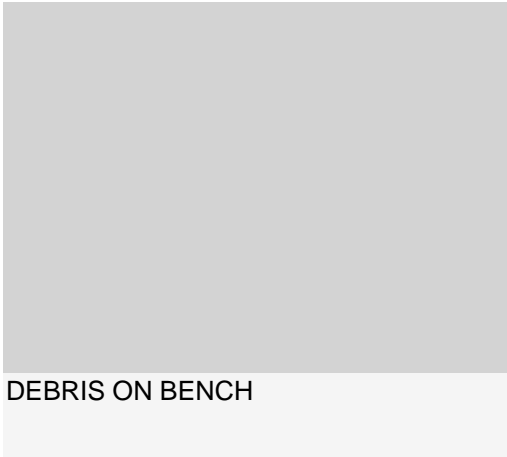

DEBRIS ON BENCH

Top View



VERY DIFFICULT FOR TOP SHOT DUE TO DEPTH AND FOG

GRADE ADJUSTMENT



LOOSE BRICKS AND DETERIORATED

Defect 2



EVIDENCE OF SURCHARGE

Defect 3



INFILTRATION ON BARREL WALL

Defect 4



INFILTRATION ALONG BARREL FROM  
MORTAR

## Manhole Inspection Summary

Manhole # S05Y\_\_010MH

Printed On: 6/24/2010

Page 4 of 5

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **29.40** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow

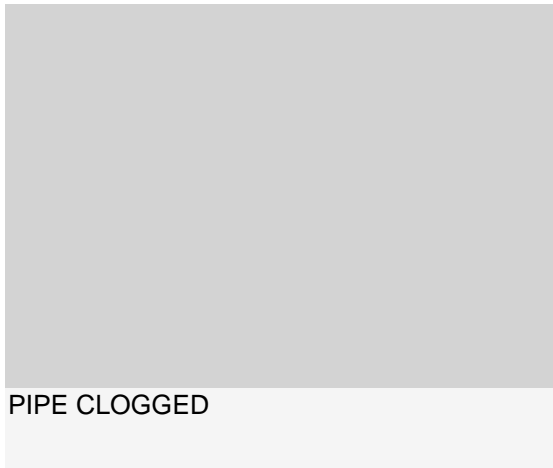

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **29.00** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☒ **Sludge** ☒ **Debris** ☐ Grease

Silt Depth: **8** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection

# Manhole Inspection Summary

Manhole # S05Y\_\_010MH

Printed On: 6/24/2010


Page 5 of 5

8 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock

Drop In @ 6 O'Clock

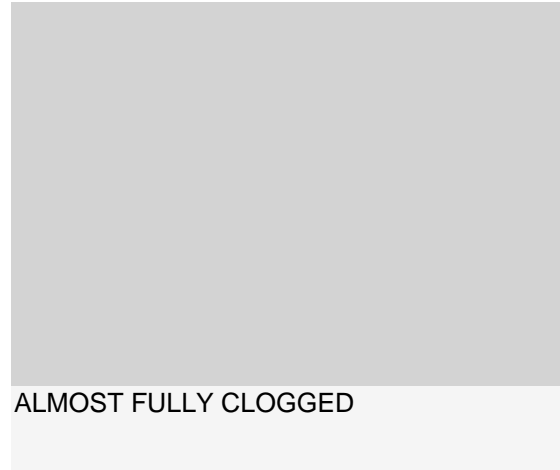

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **19.30** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **7** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **28.10** (ft.)

Inv Depth: **29.10** (ft.)

Drop Condition: **Partly Clogged**


Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock

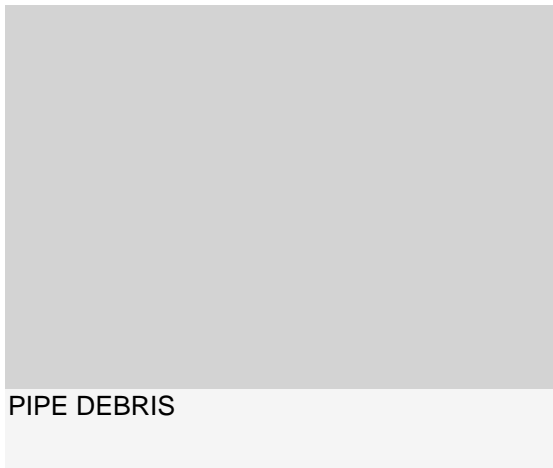

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **28.90** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **4** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection